




PLAN NO.:	BR 10003	NO	DATE	APP.	REVISIONS
SCALE:	N.T.S.	A	00/03/16	JEB	UPDATE TO CSM BRUSHING STANDARDS
DESCRIPTION:	DRAWN: D. STURKO	B	09/06/16	CC	CLEANUP COLORIZE DWG
	DATE: 99/11/22				
	CHECKED: JE BILLINTON				
	APPROVED: JE BILLINTON				

BRUSHING REQUIREMENT
THREE PHASE/X-ARM
HIGH VOLTAGE LINE
UP TO 34kV

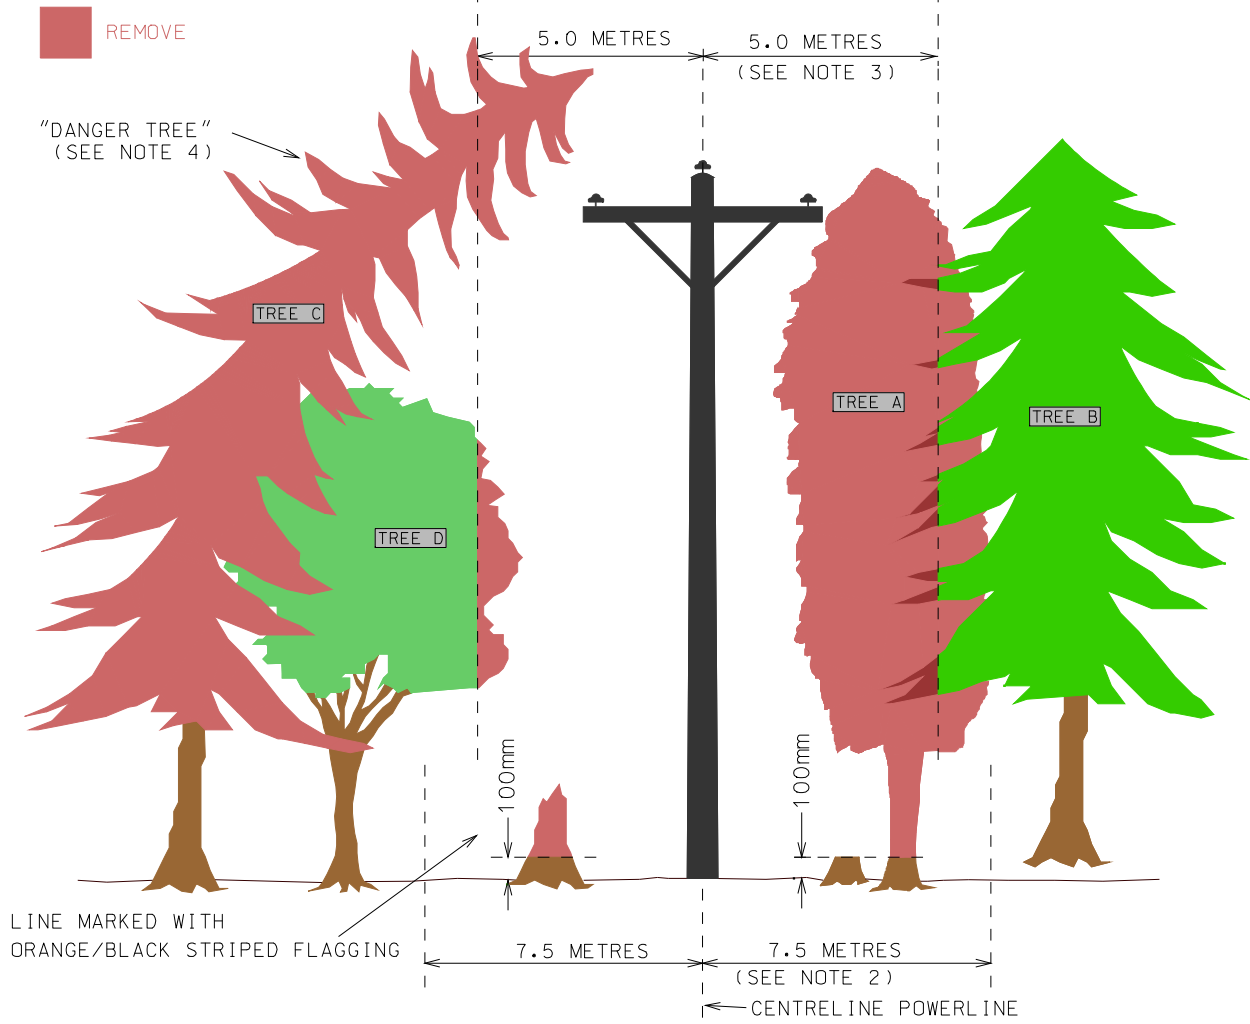

IMPORTANT NOTES

1. ALL TREES, LIMBS, DEADFALL AND BRUSH ARE TO BE REMOVED AS MARKED WITH ORANGE/BLACK STRIPED FLAGGING.
2. ALL TREES WITH STUMPS WITHIN 7.5M OF THE CENTRELINE ARE TO BE REMOVED.(SEE TREE A IN DIAGRAM ABOVE).
3. TREES THAT HAVE THE STUMPS OUTSIDE OF THE 7.5M FROM CENTRELINE IDENTIFIED IN NOTE 2 ARE TO HAVE ALL LIMBS AND BRANCHES BRUSHED/TRIMMED TO 5.0M FROM CENTRELINE (SEE TREE B IN DIAGRAM ABOVE). IF TRIMMING IS NOT AN OPTION THEN THE TREE MUST BE REMOVED.
4. ALL TREES LEANING TOWARD THE BRUSHED RIGHT OF WAY ARE CONSIDERED "DANGER TREES" AND MUST BE REMOVED. (SEE TREE "C" IN DIAGRAM)
5. ALL STUMPS TO BE CUT FLUSH OR AS CLOSE TO THE GROUND, NOT TO EXCEED 100MM FROM GROUND LEVEL.
6. ALL DEAD OR ROTTING TREES ADJACENT TO THE RIGHT OF WAY MUST BE REMOVED.
7. ALL FLAGGING DONE ON SITE INDICATES ABSOLUTE MINIMUM BRUSH REMOVAL, THE RIGHT OF WAY IS TO BE CLEARED OF ALL VEGETATION AND OBSTACLES WHICH ARE INCOMPATIBLE WITH THE OPERATION OF AN ELECTRICAL SYSTEM.